

| Company / Type | Model Name | Model Number | Date of Manufacture Affected | Issue | Action |
|---|-----------------|---|--|---|--|
| Recall List - updated 3-Feb-2026 While every effort has been made to ensure the accuracy of this list it is always advisable to have caregivers confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org . If a brand is not listed: there are no active recalls for that brand as of the date of this summary. Scan the QR code to view this list online, with direct links to the full alert. | | | | |  |
| Clek - RFO | Liing Liingo | LG19C1 LGO20C1 | 1-May-2019 to 14-Sep-2020 20-May-2020 to 14-Sep-2020 | Infants could choke on a small piece of the canopy stay taken from the seat. | Contact Clek for repair kit. |
| Clek - RFO | Liing Liingo | LG19C1 LGO20C1 | 27-Mar-2019 to 22-Feb-2021 20-May-2020 to 22-Feb-2021 | Infants could choke on a small piece of the warning label taken from the cover or headrest. | Contact Clek for repair kit. |
| Clek - convertible | Foonf Fllo | FO12C1, FO14C1, FO15C1, FO16C1, FO17C1, FO18C1, FO19C1 FL15C1, FL16C1, FL17C1, FL18C1, FL19C1 | Before May 21, 2021 | After repeated picking, a child may be able to remove small pieces of Expanded Polypropylene (EPP) foam and put the small pieces into their mouth, nose or ear. | Contact Clek for plastic insert to cover crotch buckle opening. |
| Cybex | Aton G Swivel | "Article number" : 522004175, 522004177, 522004179, 522004181, 522004801, 522004803 | 3-Jun-2023 to 10-May-2024 | The harness anchor hooks can be damaged; if this happens, the harness can loosen and detach from the seat. | Contact Cybex for a repair kit. If the harness anchor pin is missing or the anchor hooks are damaged: do not use the seat. |
| Diono - RFO | Radius | | ALL | Counterfeit, do not use. | Call Transport Canada |

| Company / Type | Model Name | Model Number | Date of Manufacture Affected | Issue | Action |
|-----------------------|---|---|-------------------------------------|--|--|
| Diono - all-in-one | Radian 3QX Radian 3QXT Radian 3R SafePlus 3RXT SafePlus **check Transport Canada alert for full list of affected products by serial number (too extensive to list here)** | 50320-NA-01; 50321-NA-01; 50323-NA-01, 50324-NA-01, 50325-NA-01, 50326-NA-01, 51220-NA-01, 51221-NA-01, 51223-NA-01, 51224-NA-01, 51225-NA-01, 51226-NA-01, 53000-NA-01, 53001-NA-01, 50630-NA-01, 50632-NA-01, 50633-NA-01, 50634-NA-01, 50635-NA-01, 50636-NA-01, 50637-NA-01, 50100-NA-01, 50101-NA-01, 50103-NA-01, 50104-NA-01, 50105-NA-01, 50106-NA-01, 50107-NA-01, 50108-NA-01, 50150-NA-01, 50152-NA-01 | December 2019 through November 2024 | Certain child seats may not meet the requirements of the Canadian regulations when installed in a rear-facing position using the universal anchorage system (UAS). | Install using the vehicle seat belt. Contact Diono to obtain a remedy kit. |
| Diono - booster | Cambria 2 | 31200-CA-01 31201-CA-01 31202-CA-01 | 5-Sep-2020 to 30-Nov-2020 | The headrest can completely separate during dynamic crash testing and do not meet the full dynamic requirements of the RSSR. | Contact Diono; remove the backrest and use backless until receiving a replacement kit. |
| Evenflo - convertible | Titan 65 | 37111835C, 37111835CD | 1-Mar-2025 to 11-Dec-2025 | May have shipped without the tether. | Do not use forward facing without tether; contact Evenflo for replacement tether. |
| Evenflo - all-in-one | All4One | 39312234C, 39312240C, 39312241C, 39312408C, 39312441C | July 2022 to December 2022 | If the child restraint changes its recline position in a crash, a vehicle occupant adjacent to the child restraint is at risk of injury if their fingers are inside the opening above the recline indicator. | Contact Evenflo for replacement seat; continue to use the seat in the meantime. |
| Evenflo - all-in-one | Revolve360 Slim | 36812449C, 36812449CPOP, 36812450C, 36812467C, 36812470C, 36812470CV | May 2023 to June 2025 | A child sitting in some Evenflo Revolve360 Slim convertible car seats may be able to pick off small pieces of foam from the headrest and put them in their mouth or nose. | Contact Evenflo for fix kit |

| Company / Type | Model Name | Model Number | Date of Manufacture Affected | Issue | Action |
|-----------------------|----------------------|---|---|--|--|
| Evenflo - all-in-one | Revolve360 Slim | 36812449C, 36812449CPOP, 36812450C, 36812467C, 36812470C, 36812470CV | May 2023 to June 2025 | Certain child seats may not meet the requirements of the Canadian regulations when installed in a rear-facing position using the vehicle seat belt and tether. | Contact Evenflo; install seat with lower anchors, or turn forward facing while awaiting fix kit. |
| Evenflo - all-in-one | Revolve360 Slim | 36812449C, 36812449CPOP, 36812450C, 36812467C, 36812470C, 36812470CV | May 2023 to June 2025 | Due to a translation error, the relevant label on the child seat omits the requirement to utilize the tether when installing the child seat in rear facing mode. In addition, the French language label references potential use of the child seat in booster mode, for which it is not designed or certified. The equivalent English language label on the child seat is compliant. | Contact Evenflo for a replacement label. |
| Graco - booster | Turbo | 1971444 1970763 | 27-Feb-2016 to 12-Apr-2016 26-Feb-2016 | The instruction manual does not contain a statement indicating that the booster seat, even when unoccupied, must be firmly secured to the vehicle. | Download revised manual; secure booster to vehicle. |
| Harmony - combination | Optyma | 0302010RBK with serial number ranges: YY20171227677200001-00489 YY20171229677300001-00473 YY20180102677400001-00473 YY20171229677700001-00060 | 27-Dec-2017 to 2-Jan-2018 | If the straps are positioned without covering the opening on the splitter plate, they can potentially loosen or become unsecured from the splitter plate. | Contact Harmony for sleeve to cover splitter plate opening |
| Maxi-Cosi - RFO | Coral XP and XP base | 22304CFNA, 22304CFNB, 22304CFNC, 22304CFND, 22524CBLK | All models manufactured in 2020, 2021, and 2022 | The lower universal anchorage system (UAS) used to attach the seat base could fail. If this happens, the seat could detach in a collision. | Contact Maxi-Cosi to receive replacement base. Install car seat baseless, or install base using vehicle seat belt. |
| Maxi-Cosi - RFO | Mico XP Max | 22321CFJB, 22321CFNA*, 22321CFNC, 22526CBLK *Maxi-Cosi Mico XP Max model 22321CFNA was also sold with Lila CP Travel system model 01371CFNA | All models manufactured in 2020, 2021, and 2022 | The lower universal anchorage system (UAS) used to attach the seat base could fail. If this happens, the seat could detach in a collision. | Contact Maxi-Cosi to receive replacement base. Install car seat baseless, or install base using vehicle seat belt. |

| Company / Type | Model Name | Model Number | Date of Manufacture Affected | Issue | Action |
|----------------------------|------------|--|------------------------------|--|--|
| Nuna - convertible | Rava | CS5102CV, CS5102GR, CS5102NT, CS5102LK, CS05108RVT, CS05112RFD, CS05113HAZ, CS05123MIN, CS05125DDC | 25-Nov-2018 to 20-Dec-2024 | Food or debris can interfere with the safe and proper working of the front adjuster locking mechanism. | Check that the harness straps stay tight by pulling on the straps every time you place a child in the car seat. Contact Nuna Canada for a new seat pad and cleaning kit. |
| Volvo - booster (built-in) | | 850 - 1998 S40 - 01-05 V40 - 01-04 V50 - 05-06 V70 - 00-06 XC70 - 01-06 XC90 - 03-06 | See list at left | Inappropriate weight range. | Do not use integrated booster until 40lbs |