

Company / Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Recall List - updated 09-Aug-2026 While every effort has been made to ensure the accuracy of this list it is always advisable to have caregivers confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org. If a brand is not listed: there are no active recalls for that brand as of the date of this summary. Scan the QR code to view this list online, with direct links to the full alert.					
Clek - RFO	Liing Liingo	LG19C1 LGO20C1	1-May-2019 to 14-Sep-2020 20-May-2020 to 14-Sep-2020	Infants could choke on a small piece of the canopy stay taken from the seat.	Contact Clek for repair kit.
Clek - RFO	Liing Liingo	LG19C1 LGO20C1	27-Mar-2019 to 22-Feb-2021 20-May-2020 to 22-Feb-2021	Infants could choke on a small piece of the warning label taken from the cover or headrest.	Contact Clek for repair kit.
Clek - convertible	Foonf Filo	FO12C1, FO14C1, FO15C1, FO16C1, FO17C1, FO18C1, FO19C1 FL15C1, FL16C1, FL17C1, FL18C1, FL19C1	Before May 21, 2021	After repeated picking, a child may be able to remove small pieces of Expanded Polypropylene (EPP) foam and put the small pieces into their mouth, nose or ear.	Contact Clek for plastic insert to cover crotch buckle opening.
Cybex	Aton G Swivel	"Article number" : 522004175, 522004177, 522004179, 522004181, 522004801, 522004803	3-Jun-2023 to 10- May-2024	The harness anchor hooks can be damaged; if this happens, the harness can loosen and detach from the seat.	Contact Cybex for a repair kit. If the harness anchor pin is missing or the anchor hooks are damaged: do not use the seat.
Diono - RFO	LiteClik30 XT SafePlus	56100-NA-01, 56101-NA-01, 56102-NA-01, 56103-NA-01, 56104-NA-01, 56105-NA-01	24-Jul-2024 to 12-Oct-2024	Some labels and instructions for the recommended use-positions of the carry handle may be missing or incorrect. When the carrier is installed with the base you may use handle position 2 only. DO NOT use any other handle positions, as the carrier may detach during a collision.	Contact Diono to obtain a free label and owner's manual insert and instructions for how to install the label
Diono - RFO	Radius		ALL	Counterfeit, do not use.	Call Transport Canada

Company / Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Diono - all-in-one	Radian 3QX Radian 3QXT Radian 3R SafePlus 3RXT SafePlus **check Transport Canada alert for full list of affected products by serial number (too extensive to list here)**	50320-NA-01; 50321-NA-01; 50323-NA-01, 50324-NA-01, 50325-NA-01, 50326-NA-01, 51220-NA-01, 51221-NA-01, 51223-NA-01, 51224-NA-01, 51225-NA-01, 51226-NA-01, 53000-NA-01, 53001-NA-01, 50630-NA-01, 50632-NA-01, 50633-NA-01, 50634-NA-01, 50635-NA-01, 50636-NA-01, 50637-NA-01, 50100-NA-01, 50101-NA-01, 50103-NA-01, 50104-NA-01, 50105-NA-01, 50106-NA-01, 50107-NA-01, 50108-NA-01, 50150-NA-01, 50152-NA-01	December 2019 through November 2024	Certain child seats may not meet the requirements of the Canadian regulations when installed in a rear-facing position using the universal anchorage system (UAS).	Install using the vehicle seat belt. Contact Diono to obtain a remedy kit.
Diono - booster	Cambria 2	31200-CA-01 31201-CA-01 31202-CA-01	5-Sep-2020 to 30-Nov-2020	The headrest can completely separate during dynamic crash testing and do not meet the full dynamic requirements of the RSSR.	Contact Diono; remove the backrest and use backless until receiving a replacement kit.
Evenflo	Various	PIVOT XPAND TS W/LTMX AYRSHIRE BLACK (SKU: TS100612454) OMNI ULTRA TRAVEL SYSTEM WITH REVOLVE180 LITEMAX NXT PACIFIC GREEN (SKU: TS160112514) REVOLVE360 EXTEND QUARTZ (SKU: CS360212311)	2024 to 2025	Some individual units manufactured and certified for use in the United States were inadvertently shipped to Canada NOTE: The recall covers only U.S. versions of the affected Models. Canadian versions have a "C" in the twelfth position of the model number and are not affected.	If your stroller or infant/child seat is missing French instructions and/or a French label, you should contact Evenflo to obtain free replacement(s).
Evenflo - convertible	REO	CS260212521C, CS260212538C	Feb 2025 to June 2026	In forward-facing mode in headrest positions 10 or 11, or in rear-facing mode in position 11, the headrest may experience a change in position.	Contact Evenflo for repair kit; until then, do not use positions 10 or 11 forward facing, or position 11 rear facing.
Evenflo - convertible	Titan 65	37111835C, 37111835CD	1-Mar-2025 to 11-Dec-2025	May have shipped without the tether.	Do not use forward facing without tether; contact Evenflo for replacement tether.

Company / Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Evenflo - all-in-one	Revolve360 Slim	36812449C, 36812449CPOP, 36812450C, 36812467C, 36812470C, 36812470CV	May 2023 to June 2025	A child sitting in some Evenflo Revolve360 Slim convertible car seats may be able to pick off small pieces of foam from the headrest and put them in their mouth or nose.	Contact Evenflo for fix kit
Evenflo - all-in-one	Revolve360 Slim	36812449C, 36812449CPOP, 36812450C, 36812467C, 36812470C, 36812470CV	May 2023 to June 2025	Certain child seats may not meet the requirements of the Canadian regulations when installed in a rear-facing position using the vehicle seat belt and tether.	Contact Evenflo; install seat with lower anchors, or turn forward facing while awaiting fix kit.
Evenflo - all-in-one	Revolve360 Slim	36812449C, 36812449CPOP, 36812450C, 36812467C, 36812470C, 36812470CV	May 2023 to June 2025	Due to a translation error, the relevant label on the child seat omits the requirement to utilize the tether when installing the child seat in rear facing mode. In addition, the French language label references potential use of the child seat in booster mode, for which it is not designed or certified. The equivalent English language label on the child seat is compliant.	Contact Evenflo for a replacement label.
Evenflo - all-in-one	All4One	39312234C, 39312240C, 39312241C, 39312408C, 39312441C	July 2022 to December 2022	If the child restraint changes its recline position in a crash, a vehicle occupant adjacent to the child restraint is at risk of injury if their fingers are inside the opening above the recline indicator.	Contact Evenflo for replacement seat; continue to use the seat in the meantime.
Graco - booster	Turbo	1971444 1970763	27-Feb-2016 to 12-Apr-2016 26-Feb-2016	The instruction manual does not contain a statement indicating that the booster seat, even when unoccupied, must be firmly secured to the vehicle.	Download revised manual; secure booster to vehicle.
Harmony - combination	Optyma	0302010RBK with serial number ranges: YY20171227677200001-00489 YY20171229677300001-00473 YY20180102677400001-00473 YY20171229677700001-00060	27-Dec-2017 to 2-Jan-2018	If the straps are positioned without covering the opening on the splitter plate, they can potentially loosen or become unsecured from the splitter plate.	Contact Harmony for sleeve to cover splitter plate opening

Company / Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Maxi-Cosi - RFO	Coral XP and XP base	22304CFNA, 22304CFNB, 22304CFNC, 22304CFND, 22524CBLK	All models manufactured in 2020, 2021, and 2022	The lower universal anchorage system (UAS) used to attach the seat base could fail. If this happens, the seat could detach in a collision.	Contact Maxi-Cosi to receive replacement base. Install car seat baseless, or install base using vehicle seat belt.
Maxi-Cosi - RFO	Mico XP Max	22321CFJB, 22321CFNA*, 22321CFNC, 22526CBLK *Maxi-Cosi Mico XP Max model 22321CFNA was also sold with Lila CP Travel system model 01371CFNA	All models manufactured in 2020, 2021, and 2022	The lower universal anchorage system (UAS) used to attach the seat base could fail. If this happens, the seat could detach in a collision.	Contact Maxi-Cosi to receive replacement base. Install car seat baseless, or install base using vehicle seat belt.
Nuna - convertible	Rava	CS5102CV, CS5102GR, CS5102NT, CS5102LK, CS05108RVT, CS05112RFD, CS05113HAZ, CS05123MIN, CS05125DDC	25-Nov-2018 to 20-Dec-2024	Food or debris can interfere with the safe and proper working of the front adjuster locking mechanism.	Check that the harness straps stay tight by pulling on the straps every time you place a child in the car seat. Contact Nuna Canada for a new seat pad and cleaning kit.
Volvo - booster (built-in)		850 - 1998 S40 - 01-05 V40 - 01-04 V50 - 05-06 V70 - 00-06 XC70 - 01-06 XC90 - 03-06	See list at left	Inappropriate weight range.	Do not use integrated booster until 40lbs