| Company / Type | Model Name | Model Number | Date of Manufacture Affected | Issue | Action |
|------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------|
| Recall List - u While every eff Canada and/ou list is a summa brand is not lis with direct links | | | | | |
| Apramo - booster | Apramo | 046-6045 (K11-1618CTC) 199-5607 (K11-1631CTC) | Sept 2013 to Sept 2015 | Does not meet the stiffness requirements of the RSSR. | Discontinue use; return affected product to Canadian Tire |
| Britax - convertible | Advocate ClickTight Boulevard ClickTight Marathon ClickTight | E9LV55N, E9LV55Q, E9LV55Z E9LV45Q, E9LV45S, E9LV46A, E9LV46H E9LV31Q, E9LV35R, E9LV36B, E9LV36L, E9LV36N | 1-Aug-2014 to 29- Jul-2015 | Harness adjuster buttons (red) may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat. | Call Britax for fix kit (lubricant for adjuster mechanism) |
| Clek - RFO | Liing Liingo | LG19C1 LGO20C1 | 1-May-2019 to 14-Sep-2020 20-May-2020 to 14-Sep-2020 | Infants could choke on a small piece of the canopy stay taken from the seat. | Contact Clek for repair kit. |
| Clek - RFO | Liing Liingo | LG19C1 LGO20C1 | 27-Mar-2019 to 22-Feb-2021 20-May-2020 to 22-Feb-2021 | Infants could choke on a small piece of the warning label taken from the cover or headrest. | Contact Clek for repair kit. |
| Clek - convertible | Foonf | F012C1, FOONF C1 2014 Foonf F014C1, F015C1, F016C1 | 1-Dec-2012 to 10- May-2016 | When installed forward-facing with a lap belt only and top tether in Recline Position 1, the car seat did not meet the dynamic requirements for chest acceleration of the RSSR. | Use Recline Position 2 when FF with lap belt and tether; contact Clek for updated labels. |
| Clek - convertible | Foonf Fllo | FO12C1, FO14C1, FO15C1, FO16C1, FO17C1, FO18C1, FO19C1 FL15C1, FL16C1, FL17C1, | Before May 21, 2021 | After repeated picking, a child may be able to remove small pieces of Expanded Polypropylene (EPP) foam and put the small pieces into their mouth, nose or ear. | Contact Clek for plastic insert to cover crotch buckle opening. |
| Clek - booster | Oobr | FL18C1, FL19C1 OOBR - Noire colour only | 1-Apr-2016 to 22- Nov-2016 | Noire colour only; may not conform to the flammability requirements. | Obtain replacement fabric from Clek. |

| Company / Type | Model Name | Model Number | Date of Manufacture Affected | Issue | Action |
|--------------------------|---------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------|
| Cybex | Aton G Swivel | "Article number" : 522004175, 522004177, 522004179, 522004181, 522004801, 522004803 | 3-Jun-2023 to 10- May-2024 | The harness anchor hooks can be damaged; if this happens, the harness can loosen and detach from the seat. | Contact Cybex for a repair kit. If the harness anchor pin is missing or the anchor hooks are damaged: do not use the seat. |
| Diono - RFO | Radius | | ALL | Counterfeit, do not use. | Call Transport Canada |
| Diono - all-in- one | | 50320-NA-01; 50321-NA-01; 50323-NA-01, 50324-NA-01, 50325-NA-01, 50326-NA-01, 51220-NA-01, 51221-NA-01, 51223-NA-01, 51224-NA-01, 51225-NA-01, 51226-NA-01, 5000-NA-01, 50301-NA-01, 50630-NA-01, 50632-NA-01, 50633-NA-01, 50636-NA-01, 50635-NA-01, 50636-NA-01, 50101-NA-01, 50103-NA-01, 50104-NA-01, 50103-NA-01, 50106-NA-01, 50105-NA-01, 50108-NA-01, 50150-NA-01, 50108-NA-01, 50150-NA-01, 50152-NA-01 | December 2019 through November 2024 | Certain child seats may not meet the requirements of the Canadian regulations when installed in a rear- facing position using the universal anchorage system (UAS). | Install using the vehicle seat belt. Contact Diono to obtain a remedy kit. |
| Diono - booster | Cambria 2 | 31200-CA-01 31201-CA-01 31202-CA-01 | 5-Sep-2020 to 30- Nov-2020 | The headrest can completely separate during dynamic crash testing and do not meet the full dynamic requirements of the RSSR. | Contact Diono; remove the backrest and use backless until receiving a replacement kit. |
| Graco - booster | Turbo | 1971444 1970763 | 27-Feb-2016 to 12-Apr-2016 26-Feb-2016 | The instruction manual does not contain a statement indicating that the booster seat, even when unoccupied, must be firmly secured to the vehicle. | Download revised manual; secure booster to vehicle. |
| Harmony - combination | Optyma | 0302010RBK with serial number ranges: YY20171227677200001-00489 YY20171229677300001-00473 YY20180102677400001-00473 YY20171229677700001-00060 | 27-Dec-2017 to 2- Jan-2018 | If the straps are positioned without covering the opening on the splitter plate, they can potentially loosen or become unsecured from the splitter plate. | Contact Harmony for sleeve to cover splitter plate opening |

| Company / Type | Model Name | Model Number | Date of Manufacture Affected | Issue | Action |
|----------------------------------|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Kukuxumusu - booster | Kukuxumusu | 046-0735 (KU20143CM) 046-0736 (KU20153CM) | February 2013 to September 2015 | Does not meet the stiffness requirements or conform to flammability requirements of the RSSR. | Discontinue use; return affected product to Canadian Tire |
| Maxi-Cosi - RFO | Coral XP and XP base | 22304CFNA, 22304CFNB, 22304CFNC, 22304CFND, 22524CBLK | All models manufactured in 2020, 2021, and 2022 | The lower universal anchorage system (UAS) used to attach the seat base could fail. If this happens, the seat could detach in a collision. | Contact Maxi-Cosi to receive replacement base. Install car seat baseless, or install base using vehicle seat belt. |
| Maxi-Cosi - RFO | Mico XP Max | 22321CFJB, 22321CFNA*, 22321CFNC, 22526CBLK *Maxi-Cosi Mico XP Max model 22321CFNA was also sold with Lila CP Travel system model 01371CFNA | All models manufactured in 2020, 2021, and 2022 | The lower universal anchorage system (UAS) used to attach the seat base could fail. If this happens, the seat could detach in a collision. | Contact Maxi-Cosi to receive replacement base. Install car seat baseless, or install base using vehicle seat belt. |
| Nuna - convertible | Rava | CS5102CV, CS5102GR, CS5102NT, CS5102LK, CS05108RVT, CS05112RFD, CS05113HAZ, CS05123MIN, CS05125DDC | 25-Nov-2018 to 20-Dec-2024 | Food or debris can interfere with the safe and proper working of the front adjuster locking mechanism. | Check that the harness straps stay tight by pulling on the straps every time you place a child in the car seat. Contact Nuna Canada for a new seat pad and cleaning kit. |
| Volvo - booster (built-in) | | 850 - 1998 S40 - 01-05 V40 - 01-04 V50 - 05-06 V70 - 00-06 XC70 - 01-06 XC90 - 03-06 | See list at left | Inappropriate weight range. | Do not use integrated booster until 40lbs |